





Attention

- ◆ In order to obtain good measurement precision, you need to clear away the rusty, sundry, grease, etc. on the working surface.
- ◆ Please use the couplant on the working surface, measure repeatedly around the target area and take average value.
- Please clean the couplant on the transducer and working surface after measure.

1

◆ Please don't pull the transducer cable when use the instrument.



Specification Of Transducers

| | Code | Frequency | Diameter(Ød) | Measuring range |
|---|---------|-----------|--------------|-------------------------------|
| | ISU-T07 | 5.0MHz | 10.8mm | T-E: 0.8-300mm E-E: 4-25mm |
| | ISU-T06 | 7.5MHz | 8.5mm | 0.7-50mm |
| 1 | ISU-T12 | 2.0MHz | 16.3mm | 3-350mm |
| | ISU-T13 | 5.0MHz | 13mm | 3-100mm |

| Code | Minimum size ofpipe for measurement (diameter × wall thickness) | Applicable temperature | Application |
|---------|-----------------------------------------------------------------|------------------------|-------------------------|
| ISU-T07 | T-E: 20×1.2mm E-E: 20×4mm | <60°C | general use |
| ISU-T06 | 15×1.2mm | <60°C | for thin material |
| ISU-T12 | 30×4mm | <60°C | for casting steel |
| ISU-T13 | 25×3mm | <350°C | for high temperature |

10

| Glycerin | 0.075 | 1900 |
|------------------|--------|------|
| Gold | 0.075 | 3200 |
| Ice | 0.160 | 4000 |
| Inconel | | |
| | 0.220 | 5700 |
| Iron | 0.230 | 5900 |
| Iron (cast) | 0.180 | 4600 |
| Lead | 0.085 | 2200 |
| Magnesium | 0.230 | 5800 |
| Mercury | 0.057 | 1400 |
| Molybdenum | 0.250 | 6300 |
| Monel | 0.210 | 5400 |
| Neoprene | 0.063 | 1600 |
| Nickel | 0.220 | 5600 |
| Nylon, 6.6 | 0.100 | 2600 |
| Oil (SAE 30) | 0.067 | 1700 |
| Platinum | 0.130 | 3300 |
| Plexiglass | 0.110 | 1700 |
| Polythylene | 0.070 | 1900 |
| Polystyrene | 0.093 | 2400 |
| Polyurethane | 0.0700 | 1900 |
| Quartz | 0.230 | 5800 |
| Rubber, Buty | 0.070 | 1800 |
| Silver | 0.140 | 3600 |
| Steel, Mild | 0.233 | 5920 |
| Steel, Stainless | 0.228 | 5800 |
| Teflon | 0.060 | 1400 |
| Tin | 0.130 | 3300 |
| Titanium | 0.240 | 6100 |
| Tungsten | 0.200 | 5200 |
| Uranium | 0.130 | 3400 |
| Water | 0.584 | 1480 |
| Zinc | 0.170 | 4200 |

Technical Specification

| T-E: 0.8mm~300mm | | |
|----------------------------------------------|--|--|
| E-E: 4mm~25mm | | |
| 0.01mm(0.001"), 0.1mm (0.01") | | |
| 1000m/s~9999m/s | | |
| 4 /s and 10/s in fast mode | | |
| 2 to 9 times average measurement | | |
| With Low-high indication and alarm | | |
| mm / inch | | |
| Memory of 5000 readings with location number | | |
| USB to PC | | |
| 128×64 LCD with back light | | |
| 2 x AAA Batteries | | |
| -20℃~+50℃ | | |
| -20°C ~+350°C (according to the probes) | | |
| 116mm (L)×64mm(W)×27mm (H) | | |
| 0.22kg | | |
| | | |

Standard delivery

| Mainunit | 1pc |
|------------------------------------------|-------------|
| Transducer ISU-T07 | 1pc |
| Battery(AAA) | 2pcs |
| Couplant (for ISU-T06, ISU-T07, ISU-T12) | 1bottle |
| USB cable and software disc | 1pc of each |

Optional Accessory

| Transducer | ISU-T06, ISU-T12, ISU-T13 | |
|------------------------|---------------------------|--|
| Couplant (for ISU-T13) | ISU-HT5-COUPLANT | |

9

| Codel | Measuring Range | Frequency | Temperature | |
|---------|----------------------------|---------------------|---------------|--|
| ISU-T07 | T-E: 0.8-300mm/0.03-12.00" | 5.0MHZ <60°C/140° F | | |
| | E-E: 4.0-25mm/0.16-1" | | | |
| ISU-T06 | 0.7-50mm/0.03-2.00" | 7.5MHZ | <60°C/140° F | |
| ISU-T12 | 3.0-350mm/0.12-13.00" | 2.0MHZ | <60℃/140° F | |
| ISU-T13 | 3.0-100mm/0.12-4.00" | 5.0MHZ | <350°C/662° F | |

Overview the display unit



- 1. LCD Screen
- 2. Key Pad
- 3. Battery Pack

3

4. Transducer Port

5. 4.00mm Block

Key Functions

- Press key into the menu, the screen will display:
- 2. Gain adjustment 3. Language 1. Power off 5. Default 6. Information 4. Contrast
- Press or key into the selected item, press key to confirm.
- 1. Power off
- Auto shut down after 1 Min. 3 Min. 5 Min. or Never can be selectable.
- 2. Gain adjustment
- Press ☐ key into the "Gain adjustment", the screen will display:
 A. High B. Medium C. Low D. Automatic
- Press or v key to select desired item.
- Press (a) to confirm.
- 3. Language
- To change the language: English, Portuguese, Czech.
- 4. Contrast
- To change the contrast of the screen.
- 5. Default
- When the " Default "is selected, the gauge will recover the default parameter.
- 6. Information
- The screen displays the version number and transducer number.

Sound velocity

| Material | Sound Velocity | | |
|---------------|----------------|-------|--|
| Material | Inch/µS | M/s | |
| Air | 0.013 | 330 | |
| Aluminum | 0.250 | 6300 | |
| Alumina Oxide | 0.390 | 9900 | |
| Beryllium | 0.510 | 12900 | |
| Boron Carbide | 0.430 | 11000 | |
| Brass | 0.170 | 4300 | |
| Cadmium | 0.110 | 2800 | |
| Copper | 0.180 | 4700 | |
| Glass(crown) | 0.210 | 5300 | |

8



- Press key to enter/confirm.
- 3. Calibration
- Press 👩 key into menu.
- Press or key into "Calibration".
- Measure the test piece with known thickness.

If measured value is different than the known value of the test piece, adjust the measured value by pressing or vector key and then press key. The gauge will return to measure mode.



Press [0] key into the menu.

Press or key into "Memory", the screen will display:

1. Memory unit


2. Memory read

3. Delete all memory 4. Date transfer

Press or very key into the selected item, press key to confirm.

- 1. Memory unit
- The gauge has a memory capacity of 5000 measurements. The memory location was composed by alphabet A-Z + 0000-4900.
 You can select an Alphabet + an initial number freely for beginning to store the value and the next number will be followed automatically.
- Press kev into the menu.
- Press or key to select Alphabet A-Z which you want.
- Press key to confirm.
- After taking every measurement, press key to store the value with a location number.
- 2. Memory read
- Press key into the menu "Memory" "Memory Read" (Under the measurement).
- 3. Delete memory
- · Delete all memory.
- 4. Date transfer
- Press key into the menu.
- Press or wkey into "Date Transfer", the screen will display:
 The data can be transferred to PC using the data view and can be stored as DOC, TXT, Or Excel.
 - For more detailed information, refer to the "Installation Manual" enclosed in the CD.



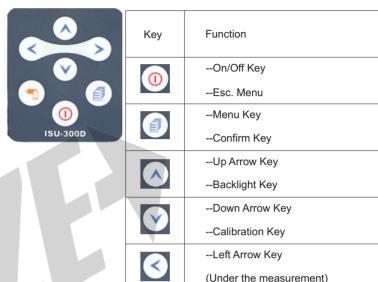

Display screen



--Right Arrow Kev

--Read data

--Storage Key

(Under the measurement)

- Measurement value
- ② Mattery life
- Measurement model
- (4) Resolution
- (5) Current transducer model
- ⑥ Current memory location
- (7) Current velocity
- (8) Gain setting

Basic gauge operations

1 Switch on

Press key o to turn on the gauge.

- 2 Probe zero
 - The gauge does an automatic zeroing of the transducer thus eliminating the need for an on-block zero. And then the gauge came into the measurement mode directly.
 - ◆ Please make sure the transducer is not coupled to the test piece when the gauge is first turned on and that there is no coolant on the end of the transducer. The transducer should also be at the room temperature, clean without any noticeable wear.
- 3 Backlight

Press \(\) key to turn on / off the backlight.

4 Measurement setting

Press key into the measurment mode setting.

Press or we key to select desired measurment mode.

Press key to confirm selection.

Press key to esc menu and into the measurement.

ISU-250C Ultrasonic Thickness Gauge offers two measurment modes, they are T-E mode and E-E mode.

- 1. T-E Mode
- Standard It is available for the normal measurement.
- ♦ Minimum The gauge will catch and display the minimum measured thickness during one measurement process. It is available for measuring the thickness of curve surface or pipe.
- ♦ Difference The gauge will display a thickness value as an absolute number of what has been inputted. For example, input value = 5.00mm and the real thickness is 5.03mm, the display will show diff 0.03mm. If the real value is 4.97mm,the gauge will display -0.03mm.

- ◆ Average The gauge will display the average thickness of 2-9 measurements.
- ◆ Limitation The gauge will alarm you of low or high thresholds via audible sound.
- ◆ Scan The gauge will alarm for each fast measurement. And will display the all measured thickness upon the complete measurement finished. It is available for measuring the thickness of test piece with high temperature surface.

2. E-E Mode

When the E-E mode is selected, only probe ISU-T07 is available. This function allows you to make measurement between two consecutive back wall echoes. Therefore, a good usage of the E-E option is for measuring through coatings (Max. 2mm) to measure only the true metal thickness.

5 Setting

- 1. Velocity rate
- ♦ Velocity setting
- Press key into VEL. SETTING state.
- There are 9 velocities for materials pre-stored in gauge. You can select one by pressing or key.
- Press key to confirm.
- ♦ Velocity input

When the sound velocity of 9 materials is not satisfied with the requirements of the users, there is a sound velocity table which give the sound velocity of various materials in the appendix.

- Press key into "Velocity input" state.
- Press
 or
 wey to select the place where you want to store
 and put the new velocity.
- Press key to confirm.
- ◆ Velocity measurement
- Measuring the sample which thickness is known.
- Press key into Velocity measurement state.
- Press key to confirm.
- ♦ Velocity store
- After you set the velocity, the instrument can store the velocity value.
- 2. Resolution
- Press 💽 key into" Resolution ".

A. 0.1mm

B. 0.01mm

C. 0.01in

D. 0.001in