



# OPERATION INSTRUCTION

## Surface Profile Gauge

Code	Range	Dial indicator stroke	Dial indicator graduation	Accuracy
2344-1	0-1mm	1mm	0.001mm	$\pm 0.005\text{mm}$



### 1. Application

Set zero before use (fig.1). Zero set block with "W" is working face.  
Measure peak-to-valley height of blast cleaned surface (fig.2).

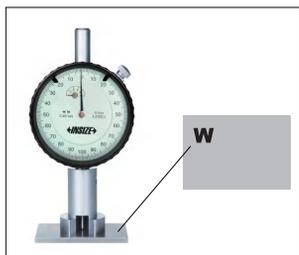


fig.1

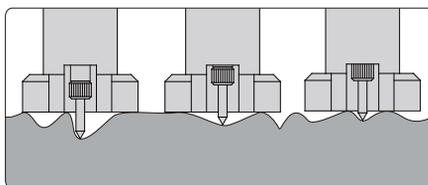


fig.2

2. After measurement, please oil base surface and tip.

MN-2344-E

V0