DATA OUTPUT

LARGE STROKE DIGITAL INDICATORS

warning when over tolerance

2117-100P/1001P

- Button function: on/off, zero, mm/inch, data preset, tolerance, change measuring direction, max./min./TIR measurement, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off
- Maximum measuring force: 3.2N
- Data output
- Optional accessory: data output cable (code **7315-50M, 7302-40M, 7305-40M**), backs (page 176~177), contact points (page 173~175)

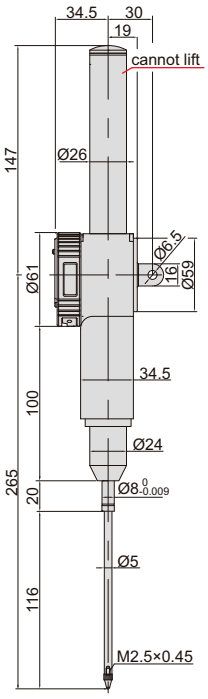

2117-100

Unit: mm

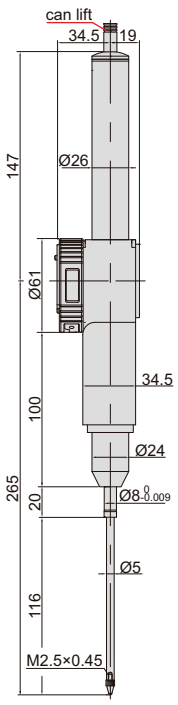

2117-100P

Resolution 0.01mm/0.0005"

Code	Range	Accuracy	Hysteresis	Remark
2117-100	100mm/4"	30μm	10μm	lug back
2117-100P	100mm/4"	30μm	10μm	flat back, with lift cap

Resolution 0.001mm/0.00005"

Code	Range	Accuracy	Hysteresis	Remark
2117-1001	100mm/4"	9μm	3μm	lug back
2117-1001P	100mm/4"	9μm	3μm	flat back, with lift cap

max./min./TIR

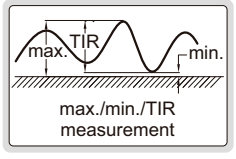

spindle lift knob is included