INSPECTION CERTIFICATE
TRACEABLE TO NIST

DATA OUTPUT
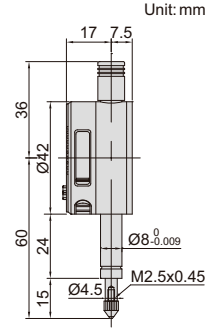
- Button function:
  in/mm: short press for inch/metric conversion
        long press to change measuring direction
  ABS: short press for absolute/incremental measurement
       long press to preset data
  0/ON: short press to turn on when power is off
       short press to set zero when power is on
       long press to turn off
- Keep preset data in memory after restart
- CR1632 battery, automatic power off
- Data output
- Optional accessory: data output cable
  (code **7315-50M, 7302-40M, 7305-40M**),
  contact points (page 173~175)

2114-51F

Unit: mm

17 7.5
36
Ø42
60
24
15
Ø4.5
Ø8 0 -0.009
M2.5x0.45

Code	Range	Resolution	Accuracy	Hysteresis	Remark
2114-5F *	5mm/0.2"	0.01mm/0.0005"	20µm	10µm	flat back
2114-51F *	5mm/0.2"	0.001mm/0.00005"	5µm	2µm	flat back

*Supplied with manufacturer inspection certificate traceable to NIST USA