BACK PLUNGER TYPE DIGITAL INDICATORS





alarm when over tolerance










- Display can rotate 320°, and display direction is changeable
- Reading in digital and analog
- Button function: tolerance Go and No-Go display, data preset, measuring direction change, max./min./TIR measurement, inch/metric conversion, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off (time is adjustable)
- Data output
- Optional accessory: wireless transmitter code 7315-50M (receiver is needed) page 6, bluetooth transmitter code 7214-50M page 12, data output cable code 7302-40M page 21, 7305-40M page 17, backs (page 277~278), contact points (page 272~276)



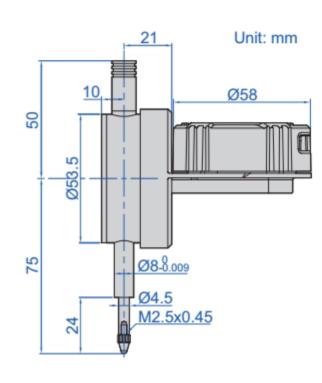



display direction is changeable

display can rotate 320°





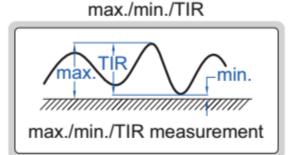

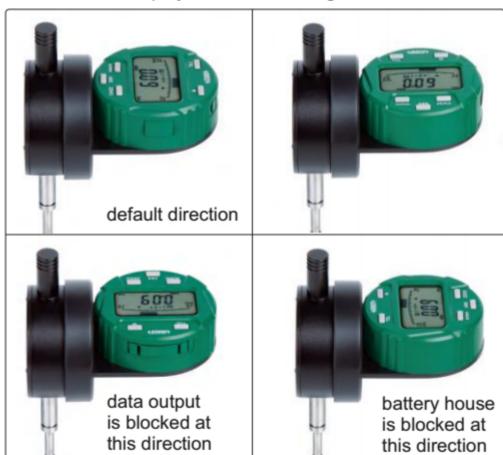

remark: to change above direction, 4 fixing screws on the back of display need to be removed first.

Code	Range	Resolution	Accuracy	Hysteresis	Maximum measuring force	Сар	Remark
2118-10 *	12.7mm/0.5"	0.01mm/0.0005"	20µm	10µm	1.5N	can lift	flat back
2118-101*	12.7mm/0.5"	0.001mm/0.00005"	5µm	2µm	1.5N	can lift	flat back

^{*}Supplied with manufacturer inspection certificate