


MICROMETER SETTING STANDARDS



6310-100



type A




6310-300

Code	Length	Type	Accuracy	D
6310-25	25	A	$\pm 1.5\mu\text{m}$	$\varnothing 7$
6310-50	50	A	$\pm 2\mu\text{m}$	$\varnothing 7$
6310-75	75	A	$\pm 2.5\mu\text{m}$	$\varnothing 7$
6310-100	100	A	$\pm 3\mu\text{m}$	$\varnothing 8$
6310-125	125	A	$\pm 3.5\mu\text{m}$	$\varnothing 8$
6310-150	150	A	$\pm 4\mu\text{m}$	$\varnothing 8$
6310-175	175	A	$\pm 4.5\mu\text{m}$	$\varnothing 8$
6310-200	200	A	$\pm 5\mu\text{m}$	$\varnothing 8$
6310-225	225	A	$\pm 5.5\mu\text{m}$	$\varnothing 8$
6310-250	250	A	$\pm 6\mu\text{m}$	$\varnothing 8$
6310-275	275	A	$\pm 6.5\mu\text{m}$	$\varnothing 8$
6310-300	300	B	$\pm 7\mu\text{m}$	$\varnothing 16$
6310-325	325	B	$\pm 7.5\mu\text{m}$	$\varnothing 16$
6310-350	350	B	$\pm 8\mu\text{m}$	$\varnothing 16$
6310-375	375	B	$\pm 8.5\mu\text{m}$	$\varnothing 16$

(mm)

Code	Length	Type	Accuracy	D
6310-400	400	B	$\pm 9\mu\text{m}$	$\varnothing 16$
6310-425	425	B	$\pm 9.5\mu\text{m}$	$\varnothing 16$
6310-450	450	B	$\pm 10\mu\text{m}$	$\varnothing 16$
6310-475	475	B	$\pm 10.5\mu\text{m}$	$\varnothing 16$
6310-500	500	B	$\pm 11\mu\text{m}$	$\varnothing 16$
6310-525	525	B	$\pm 11.5\mu\text{m}$	$\varnothing 16$
6310-575	575	B	$\pm 12.5\mu\text{m}$	$\varnothing 16$
6310-625	625	B	$\pm 13.5\mu\text{m}$	$\varnothing 16$
6310-675	675	B	$\pm 14.5\mu\text{m}$	$\varnothing 16$
6310-725	725	B	$\pm 15.5\mu\text{m}$	$\varnothing 16$
6310-775	775	B	$\pm 16.5\mu\text{m}$	$\varnothing 16$
6310-825	825	B	$\pm 17.5\mu\text{m}$	$\varnothing 16$
6310-875	875	B	$\pm 18.5\mu\text{m}$	$\varnothing 16$
6310-925	925	B	$\pm 19.5\mu\text{m}$	$\varnothing 16$
6310-975	975	B	$\pm 20.5\mu\text{m}$	$\varnothing 16$

(mm)

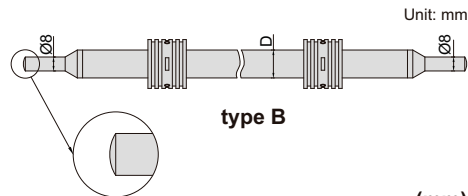

type B

Unit: mm

Code	Length	Type	Accuracy	D
6310-1050	1050	B	$\pm 22\mu\text{m}$	$\varnothing 23$
6310-1150	1150	B	$\pm 24\mu\text{m}$	$\varnothing 23$
6310-1250	1250	B	$\pm 26\mu\text{m}$	$\varnothing 23$
6310-1350	1350	B	$\pm 28\mu\text{m}$	$\varnothing 23$
6310-1450	1450	B	$\pm 30\mu\text{m}$	$\varnothing 23$
6310-1550	1550	B	$\pm 32\mu\text{m}$	$\varnothing 23$
6310-1650	1650	B	$\pm 34\mu\text{m}$	$\varnothing 23$
6310-1750	1750	B	$\pm 36\mu\text{m}$	$\varnothing 23$
6310-1850	1850	B	$\pm 38\mu\text{m}$	$\varnothing 23$
6310-1950	1950	B	$\pm 40\mu\text{m}$	$\varnothing 23$

(mm)