



### HSS, CENTER DRILLS / FORM B


🇩🇪 HSS, ZENTRIERBOHRER / FORM B

🇫🇷 Forets HSS à centrer / Forme B


🇮🇹 PUNTE A CENTRARE PER TORNII IN HSS / FORMA B



Form B(D1313)

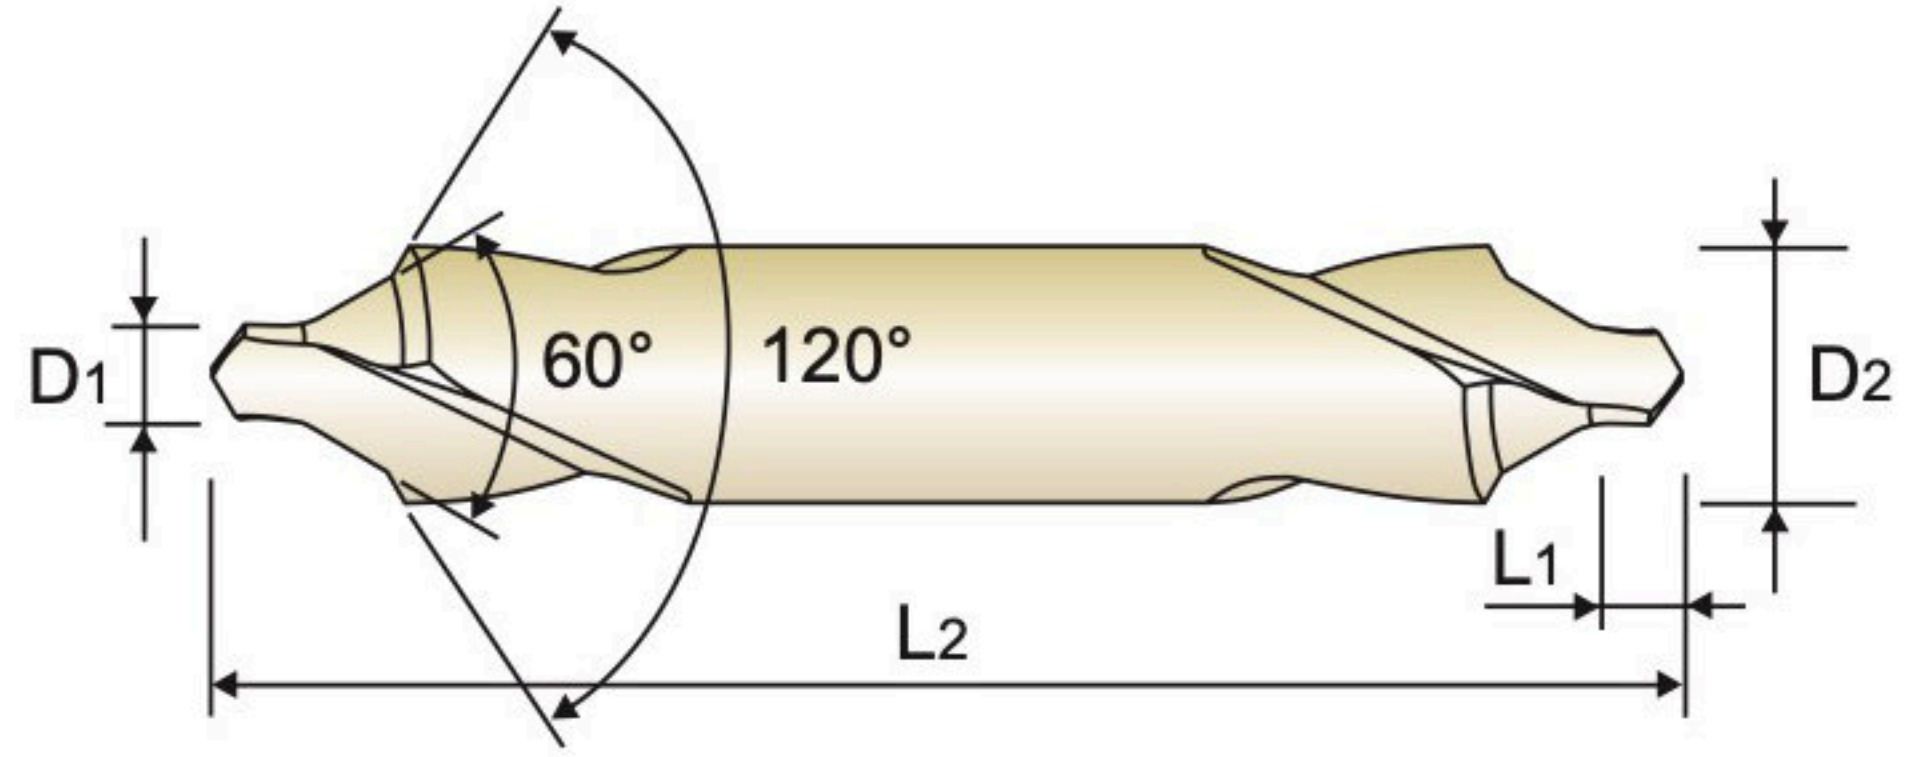

Form B(D1353)

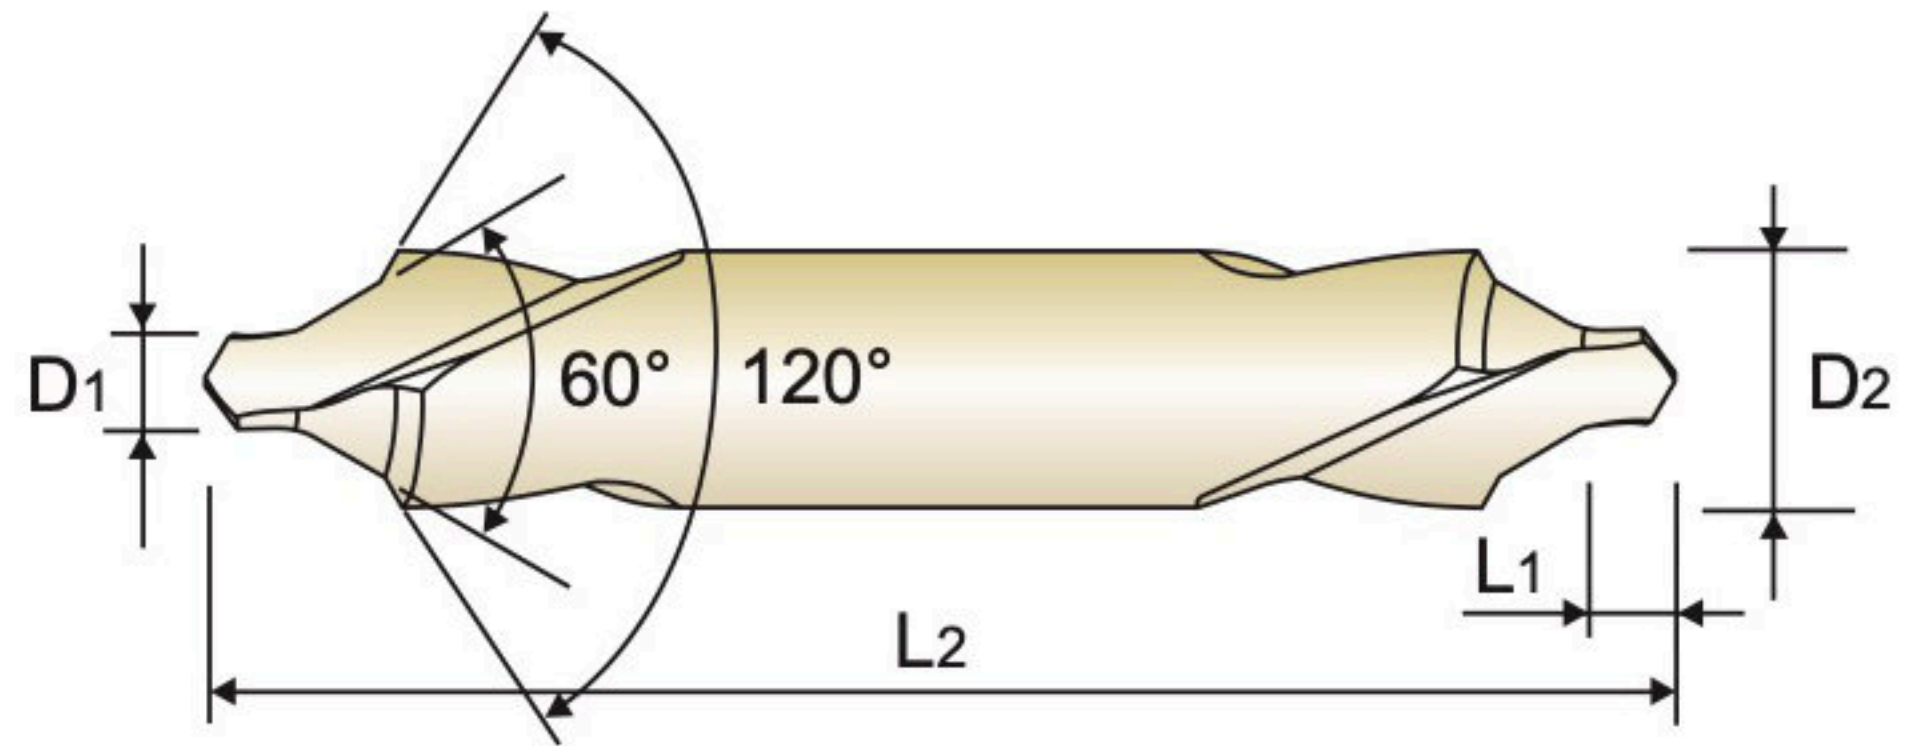

DIN 333
HSS
h8
k12
120°
Bright
p.A297

Plain Shank  
Recommended ToolHolder  
NC DRILL CHUCK & OTHER TOOL HOLDERS  
ER COLLET CHUCK


#### FORM B (60° + 120°)

EDP No.	Drill Diameter	Shank Diameter	Pilot Length	Overall Length
	D1	D2	L1	L2
D1313010	1.0	4	1.3	35.5
D1313912	1.25	5	1.6	40
D1313016	1.6	6.3	2	45
D1313020	2.0	8	2.5	50
D1313025	2.5	10	3.1	55
D1313931	3.15	11.2	3.9	60
D1313040	4.0	14	5	67
D1313050	5.0	18	6.3	75
D1313063	6.3	20	8	80

#### LEFT HELIX / FORM B (60° + 120°)

Unit : mm

EDP No.	Drill Diameter	Shank Diameter	Pilot Length	Overall Length
	D1	D2	L1	L2
D1353020	2.0	8	2.5	50
D1353025	2.5	10	3.1	55
D1353931	3.15	11.2	3.9	60
D1353040	4.0	14	5	67
D1353063	6.3	20	8	80

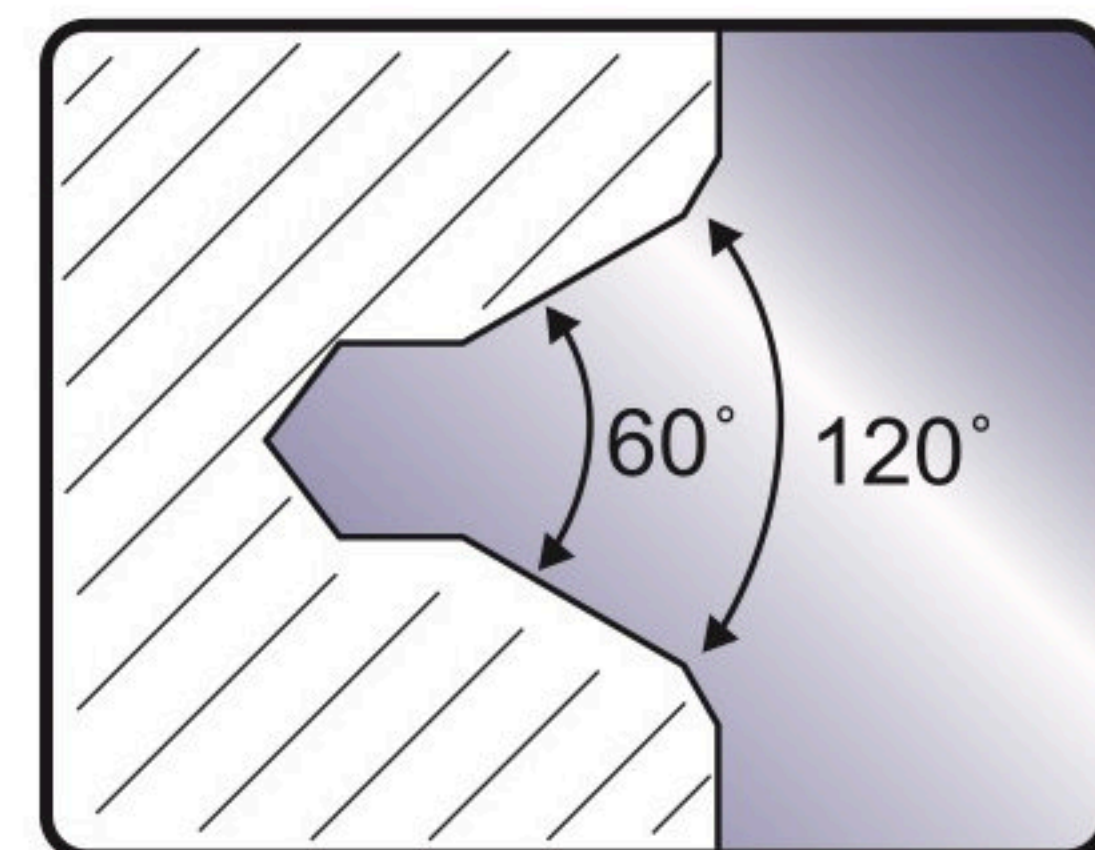

⊙ : Excellent ○ : Good

ISO Material Description	P										M			K						
	Non-alloy steel					Low alloy steel					High alloyed steel, and tool steel		Stainless steel			Grey cast iron		Nodular cast iron		Malleable cast iron
VDI 3323	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
HRc		13	25	28	32	10	29	32	38	15	35	15	23	10	10	26	3	25		21
HB	125	190	250	270	300	180	275	300	350	200	325	200	240	180	180	260	160	250	130	230
Recommended	⊙	⊙	○			⊙	○					○			⊙	○	○			○

ISO Material Description	N										S						H				
	Aluminum-wrought alloy		Aluminum-cast, alloyed			Copper and Copper Alloys (Bronze / Brass)			Non Metallic Materials		Heat Resistant Super Alloys						Titanium Alloys		Hardened steel	Chilled Cast Iron	Hardened Cast Iron
VDI 3323	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
HRc											15	30	25	38	34			55	60	42	55
HB	60	100	75	90	130	110	90	100			200	280	250	350	320	400Rm	1050Rm	550	630	400	550
Recommended																					